

H2S-AH Hydrogen Sulfide Sensor High Sensitivity



Figure 1 H2S-AH Schematic Diagram			
Ø10	12 5 000	—Worker	
ø16	13.5 PCD Reference Sensing area Do not obscure	Counter HYDROGEN SW H2S-AH 12345	7 recess
All dimensions in millimetres (± 0.1mm)			
Тор V	ïew	Bottom View Side View	
PERFORMANCE	Sensitivity	nA/ppm in 20ppm H ₂ S	950 to 1450
	Response time	t ₉₀ (s) from zero to 20ppm H ₂ S	< 30
	Zero current	ppm equivalent in zero air	< ± 0.2
	Resolution	RMS noise (ppm equivalent)	< 0.03
	Range	ppm H ₂ S limit of performance warranty	50
	Linearity Overgas limit	ppm error at full scale, linear at zero and 20ppm H_2S maximum ppm for stable response to gas pulse	0 to -2.5 250
LIFETIME	Zero drift	ppm equivalent change/year in lab air	< 0.05
	Sensitivity drift	% change/year in lab air, monthly test	< 2
	Operating life	months until 80% original signal (24 month warranted)	> 24
ENVIRONMENTAL			
	Sensitivity @ -20°C	% (output @ -20°C/output @ 20°C) @ 20ppm	80 to 92
		% (output @ 50°C/output @ 20°C) @ 20ppm	100 to 110
	Zero @ -20°C	ppm equivalent change from 20°C	< ± 0.5
	Zero @ 50°C	ppm equivalent change from 20°C	< 0.5 to -2
CROSS	NO ₂ sensitivity	% measured gas @ 10ppm NO ₂	< -30
SENSITIVITY	Cl ₂ sensitivity	% measured gas @ 10ppm Cl ₂	< -25
	NÕ sensitivity	% measured gas @ 50ppm NO	< 2
	SO ₂ sensitivity	% measured gas @ 20ppm SO ₂	< 10
	CO sensitivity	% measured gas @ 400ppm CO	< 1.5
	H ₂ sensitivity	% measured gas @ 400ppm H ₂	< 0.15
	C ₂ H ₄ sensitivity	% measured gas @ 400ppm C ₂ H ₄	< 0.15
	NH ₃ sensitivity	% measured gas @ 20ppm NH ₃	< 0.1
KEY SPECIFICATIONS			
	Temperature range		-30 to 50
	Pressure range	kPa	80 to 120
	Humidity range	% rh continuous	15 to 90
	Storage period	months @ 3 to 20°C (stored in sealed pot)	6
	Load resistor	Ω (recommended)	10 to 47
	Weight	g	< 6
At the end of the product's life, do not dispose of any electronic sensor, component or instrument in the domestic waste, but contact the instrument manufacturer, Alphasense or its distributor for disposal instructions.			

NOTE: all sensors are tested at ambient environmental conditions, with 10 ohm load resistor, unless otherwise stated. As applications of use are outside our control, the information provided is given without legal responsibility. Customers should test under their own conditions, to ensure that the sensors are suitable for their own requirements



H2S-AH Performance Data

Figure 2 Sensitivity Temperature Dependence



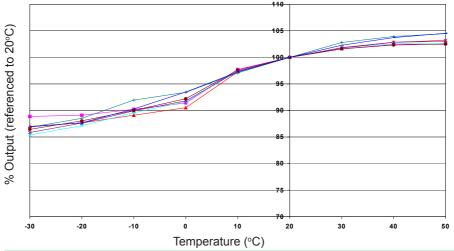


Figure 2 shows the variation in sensitivity caused by changes in temperature.

This data is taken from a typical batch of sensors.

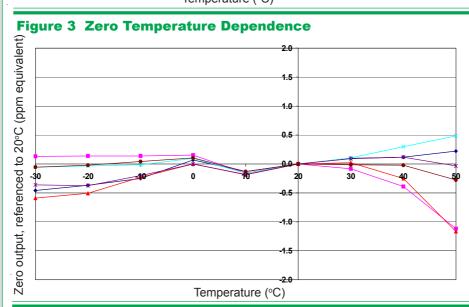


Figure 3 shows the variation in zero output caused by changes in temperature, expressed as ppm gas equivalent, referenced to zero at 20°C.

This data is taken from a typical batch of sensors.



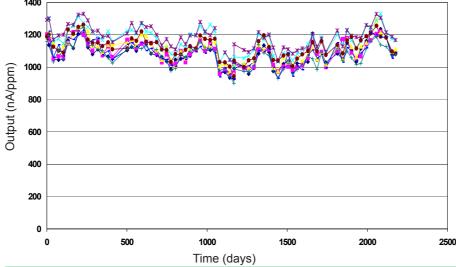


Figure 4 shows the excellent long term stability of the sensitivity of the H2S-AH resulting from the combination of patented design, superior electrochemistry and automated

For further information on the performance of this sensor, on other sensors in the range or any other subject, please contact Alphasense Ltd. For Application Notes visit "www.alphasense.com".

In the interest of continued product improvement, we reserve the right to change design features and specifications without prior notification. The data contained in this document is for guidance only. Alphasense Ltd accepts no liability for any consequential losses, injury or damage resulting from the use of this document or the information contained within. (©ALPHASENSE LTD) Doc. Ref. H2SAH/DEC15