




SO2-BE Sulfur Dioxide Sensor

High Concentration



Figure 1 SO2-BE Schematic Diagram

PATENTED

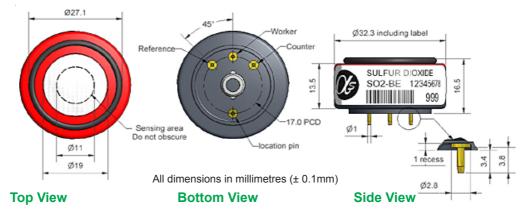

PERFORMANCE	Sensitivity Response time Zero current Resolution Range Linearity Overgas limit	nA/ppm in 20ppm SO ₂ t ₉₀ (s) from zero to 20ppm SO ₂ ppm equivalent in zero air RMS noise (ppm equivalent) ppm limit of performance warranty ppm error at full scale, linear at zero and 20ppm SO ₂ maximum ppm for stable response to gas pulse	70 to 100 < 30 < ±2 < 2 2,000 nd 10,000
LIFETIME	Zero drift Sensitivity drift Operating life	ppm equivalent change/year in lab air % change/year in lab air, monthly test months until 80% original signal (24 month warranted)	nd nd > 24
ENVIRONMENTA	Sensitivity @ -20°	C% (output @ -20°C/output @ 20°C) @ 20ppm C% (output @ 50°C/output @ 20°C) @ 20ppm ppm equivalent change from 20°C ppm equivalent change from 20°C	80 to 90 95 to 105 < ±1 < -1 to 10
CROSS SENSITIVITY	Filter capacity H ₂ S sensitivity NO ₂ sensitivity CI ₂ sensitivity NO sensitivity CO sensitivity H ₂ sensitivity C ₂ H ₄ sensitivity NH ₃ sensitivity	ppm·hrs % measured gas @ 20ppm H ₂ S % measured gas @ 10ppm NO ₂ % measured gas @ 10ppm CI ₂ % measured gas @ 50ppm NO % measured gas @ 400ppm CO % measured gas @ 400ppm H ₂ % measured gas @ 400ppm C ₂ H ₄ % measured gas @ 20ppm NH ₃	4,000 < 2 < -180 < 35 < -30 < 8 < 1.5 < 0.1
KEY SPECIFICATIONS	Humidity range Storage period Load Resistor Weight	le°C kPa % rh continuous (see note below) months @ 3 to 20°C (stored in sealed pot) Ω (recommended) g	-30 to 50 80 to 120 15 to 90 6 10 to 47 < 13

Note: Above 85% rh and 40°C a maximum continuous exposure period of 10 days is warranted. Where such exposure occurs the sensor will recover normal electrolyte volumes when allowed to rest at lower % rh and temperature levels for several days.



At the end of the product's life, do not dispose of any electronic sensor, component or instrument in the domestic waste, but contact the instrument manufacturer, Alphasense or its distributor for disposal instructions.

NOTE: all sensors tested and stored at ambient environments unless otherwise stated. As applications of use are outside our control, the information provided is given without legal responsibility. Customers should test under their own conditions, to ensure that the sensors are suitable for their own requirements.



becification

echnical

SO2-BE Performance Data

Figure 2 Sensitivity Temperature Dependence

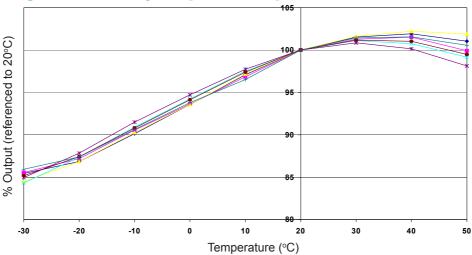


Figure 2 shows the variation in sensitivity caused by changes in temperature.

This data is taken from a typical batch of sensors.

Figure 3 Zero Temperature Dependence


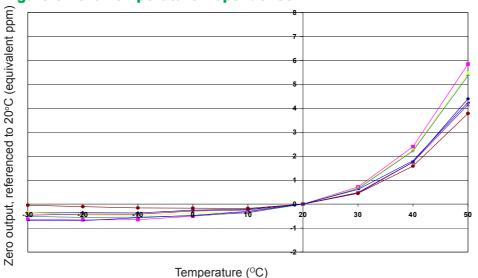


Figure 3 shows the variation in zero output caused by changes in temperature, expressed as ppm gas equivalent, referenced to zero at 20°C.

This data is taken from a typical batch of sensors.

Figure 4 Response breath test

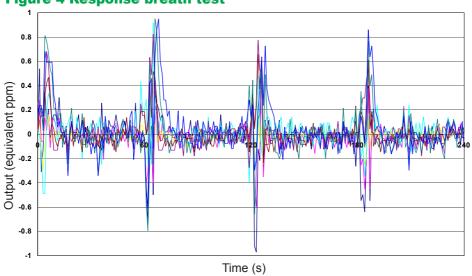

Simply breathing on a sensor causes both temperature and humidity transients.

The SO2-BE recovers rapidly, returning to zero after four consecutive breaths.

For further information on the performance of this sensor, on other sensors in the range or any other subject, please contact Alphasense Ltd. For application notes visit "www.alphasense.com".

In the interest of continued product improvement, we reserve the right to change design features and specifications without prior notification. The data contained in this document is for guidance only. Alphasense Ltd accepts no liability for any consequential losses, injury or damage resulting from the use of this document or the information contained within (@ALPHASENSE LTD) Doc. Ref. SO2BE/NOV15